
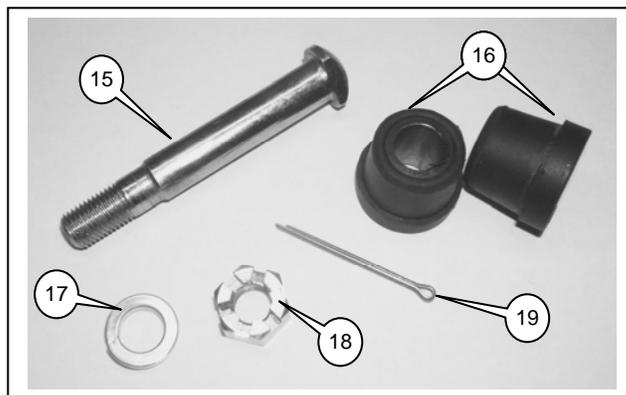


Supplemental Information & Instructions for **031-390 or 1G4349K Fulcrum Pin & Bush Kit** MGB, MGC, Austin Healey 100-3000

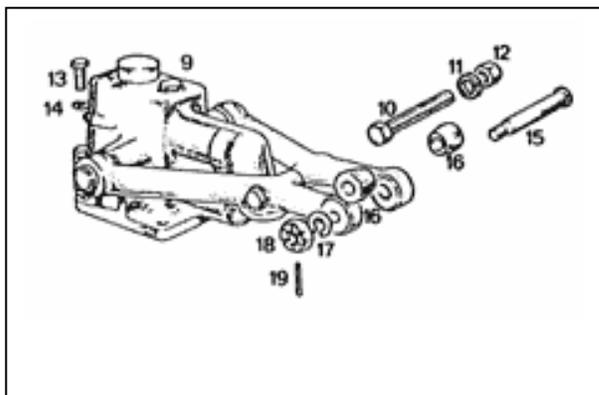

Contents of Kit

Ref	Qty	Moss US	Moss Europe	Description	Notes
15	1	263-440	1G4349	Pin, fulcrum	drilled for cotter pin
16	2	282-305	8G621	Bushing, rubber, sleeved	
17	1	324-250	GHF334	Washer, lock, 7/16"	
18	1	310-330	NL607041	Nut, slotted, 7/16 UNF	
19	1	325-330	GHF502	Cotter pin, 3/32 x 1 1/2"	

Installation Notes

Please refer to your factory workshop manual for the proper procedure. The notes here supplement, but do not replace the workshop manual.

We have gone to some trouble to supply a proper fulcrum pin drilled for the cotter pin so that you can use the same type of slotted nut originally used. The slotted nut will sometime hang up on the pin in the area where the hole was drilled. You may find it helpful to run a 7/16" UNF (20TPI) thread chaser or a die down on the first 1/2 inch of the threaded end of the pin. We apologize for the inconvenience, and we are working with our suppliers to make this additional step unnecessary.

We have been told that at one point a BMC replacement bushing was available that allowed the upper bushings (16) to be replaced on the Austin Healey without loosening the bolt (10) that holds the shock arms together and prying them apart slightly. That bushing is no longer available, and the installation of the upper trunnion with the bushings is easier if you loosen the bolt and separate the arms a little. This procedure is specifically called out in the MGB & Healey workshop manuals, but the language is confusing.



Moss Motors, Ltd.

440 Rutherford Street, Goleta, California 93117
 In the US & Canada Toll Free (800) 667-7872 FAX (805) 692-2510 (805) 681-3400

Moss Europe Ltd.

Hampton Farm Industrial Estate, Hampton Road West, Hanworth Middlesex, TW13 6DB
 In the UK: 020-8867-2020 FAX:- 020-8867-2030