



Premium Clutch Kit

PART# 190-807

Installation Notice

For: MGB, 1962-80

In checking New & Re-furbished T-arms for fitment of T-brg w/ included clips, we find that not all combos fit well.

Check of proper clip fitment shall be the responsibility of the customer/installer as we cannot control the variations in the T-arms.

In some cases it may be necessary to squeeze the clip form with pliers to increase the tension of the clip to retain the T-brg on the T-arm.

This is an easy process with little risk of damage to the clip, but does require a minor degree of finesse with the pliers.

Fitment of T-brg on T-arm is easiest to verify with T-arm removed from gear box. T-arm is easy to remove; 1 bolt.

With T-arm removed, ensure that clip tension is sufficient to enable the T-arm to stand on T-brg on a table easily without T-brg rotating and allowing T-arm to fall.



Figure 1a

Squeezing clip tighter to increase tension

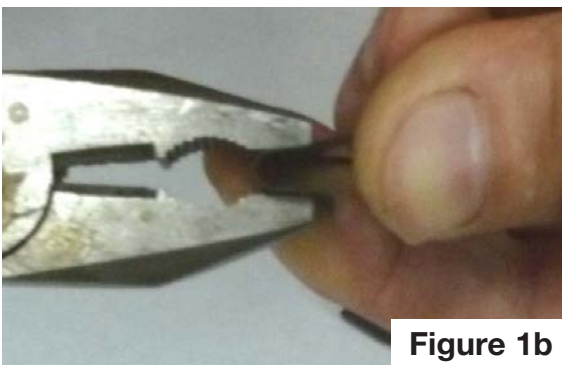


Figure 1b



Figure 2

Although every effort has been made to ensure the accuracy and clarity of this information, any suggestions that you may have that will improve the information (especially detailed installation notes and photos) are welcome. These instructions were developed and written by Moss Technical Support. If you have any questions or difficulties with your installation of this product, telephone 800-667-7872 between 7:00 a.m. and 4:00 p.m., Pacific Time for assistance.

Moss Motors, Ltd.

440 Rutherford Street, Goleta, California 93117
In the US & Canada Toll Free (800) 667-7872
LOCAL (805) 681-3400 FAX (805) 692-2510



Moss Europe Ltd.

Hampton Farm Industrial Estate
Hampton Road West, Hanworth Middlesex, TW13 6DB
In the UK: 020-8867-2020 FAX: 020-8867-2030